



WATERVILLE SEWER PRIORITY REPLACEMENTS

- ▲ VIDEO INSPECTION AREA PRIORITY NUMBER
- ① 6" VITRIFIED CLAY, PROBLEM IS ROOTS IN PIPE. PIPE IS ONLY 2" DEEP AT RAINIER STREET WITH A GRADE CHANGE OCCURRING IN THE ALLEY BEFORE IT REACHES BAKER STREET. NO MANHOLE (MH) AT GRADE CHANGE. OPTION IS TO EXPOSE THE LINE IN THE ALLEY AND SET A MH AT GRADE CHANGE AND REPLACE THE LINE UP TO WALNUT STREET.
- ② 10" CONCRETE LINE THAT WHEN LAST INSPECTED SHOWED POSSIBLE STRUCTURAL DAMAGE TO THE TOP OF THE PIPE. DAMAGE MAY HAVE BEEN CAUSED DURING INSTALLATION OF OTHER UTILITIES.
- ③ 8" VITRIFIED CLAY WITH ROOT PROBLEMS.
- ④ 8" VITRIFIED CLAY WITH ROOT PROBLEMS. LINE RUNS THROUGH BACK YARDS WITH NO ALLEY.
- ⑤ 6" VITRIFIED CLAY AND SHALLOW PROBLEMS AGAIN ARE ROOTS.
- ⑥ 6" VITRIFIED CLAY WITH ROOT PROBLEMS THAT OCCUR YEARLY.
- ⑦ 8" VITRIFIED CLAY AND POSSIBLY LINED. LINE ENTERS A BRICK MH AT ELM STREET.
- ⑧ 8" VITRIFIED CLAY LINE IS SHALLOW WITH TREES NEARBY. LINE HAS ONE CONNECTION.
- ⑨ 8" AND 6" VITRIFIED CLAY WITH ROOT PROBLEMS.
- ⑩ 8" LINE WITH A COUPLE OF LOW SPOTS.
- ⑪ 8" VITRIFIED CLAY THAT HAD ROOT PROBLEMS, TREES HAVE BEEN REMOVED.

- EXISTING SEWER
- EXISTING SEWER TO BE REPAIRED/REPLACED
- LINES TO BE VIDEO INSPECTED

VIDEO INSPECTION TABLE

PRIORITY #	APPROX. LENGTH (FT)
▲ 1	3180
▲ 2	3515
▲ 3	2115
▲ 4	1160
▲ 5	2550
▲ 6	1800
▲ 7	1690
▲ 8	620
TOTAL LENGTH:	16630

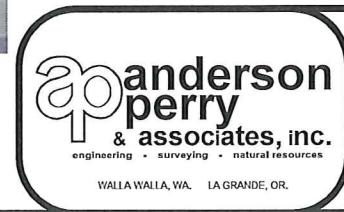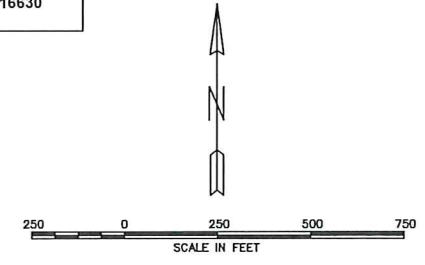

TOWN OF
WATERVILLE, WASHINGTON
SEWER VIDEO INSPECTION PRIORITIES

FIGURE
1